
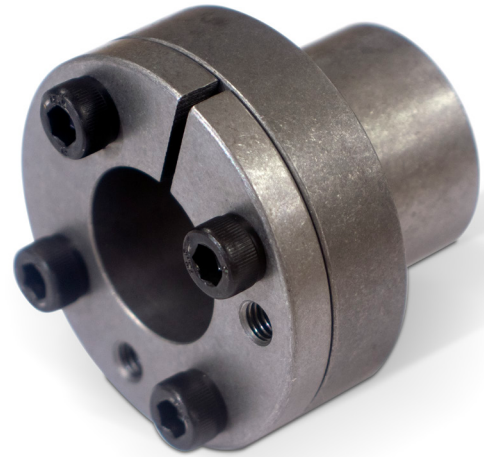


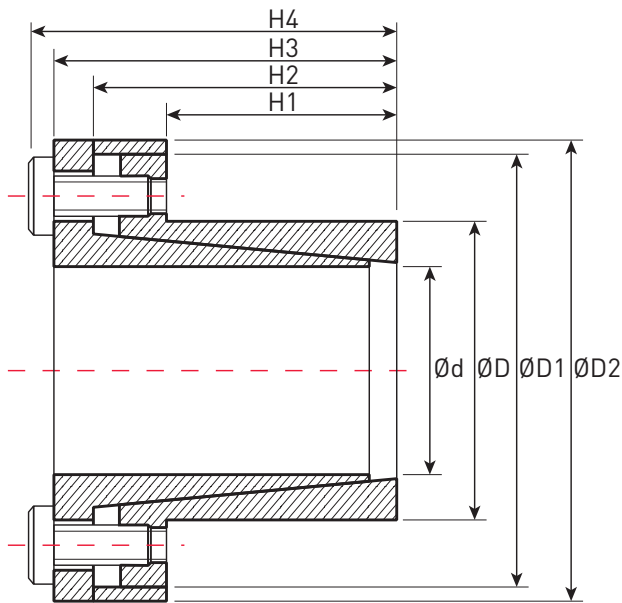

Referencia	Dimensiones mm							Tornillos 12.9			Datos técnicos			
	Ød x ØD	D1	D2	H1	H2	H3	H4	n	m	Ma Nm	Mt Nm	Fax kN	Pa N/mm²	Pm N/mm²
RB1100/6x14	6 x 14	23	25	10	19	22	26	3	M4	5	21	7	273	134
RB1100/7x15	7 x 15	24	27	12	22	25	29	3	M4	5	25	7	199	104
RB1100/8x15	8 x 15	24	27	12	22	25	29	3	M4	5	28	1	177	104
RB1100/9x16	9 x 16	26	29	14	24	27	31	4	M4	5	42	9	182	112
RB1100/10x16	10 x 16	26	29	14	24	27	31	4	M4	5	47	9	166	112
RB1100/11x18	11 x 18	28	32	14	24	27,5	31,5	4	M4	5	52	9	149	99
RB1100/12x18	12 x 18	28	32	14	24	27,5	31,5	4	M4	5	57	9	138	99
RB1100/13x23	13 x 23	33	38	14	24	27,5	31,5	4	M4	5	61	9	122	78
RB1100/14x23	14 x 23	33	38	14	24	27,5	31,6	4	M4	5	66	9	114	78
RB1100/15x24	15 x 24	40	44	16	29,5	36,5	42,5	3	M6	17	130	17	167	115
RB1100/16x24	16 x 24	40	44	16	29,5	36,5	42,5	3	M6	17	130	17	159	115
RB1100/17x25	17 x 25	42	47	18	32,5	39,5	45,5	4	M6	17	190	22	179	131
RB1100/18x26	18 x 26	42	47	18	32,5	39,5	45,5	4	M6	17	200	22	169	126
RB1100/19x27	19 x 27	43	49	18	32,5	39,5	45,5	4	M6	17	210	22	160	122
RB1100/20x28	20 x 28	44	50	18	32,5	39,5	45,5	4	M6	17	220	22	152	117
RB1100/22x32	22 x 32	48	54	25	40	47	53	4	M6	17	250	22	100	74
RB1100/24x34	24 x 34	50	56	25	40	47	53	6	M6	17	400	33	138	104
RB1100/25x34	25 x 34	50	56	25	40	47	53	6	M6	17	420	33	133	104
RB1100/28x39	28 x 39	55	61	25	40	47	53	6	M6	17	470	33	117	91
RB1100/30x41	30 x 41	57	62	25	40	47	53	6	M6	17	500	33	109	86
RB1100/32x43	32 x 43	59	65	25	40	47	53	8	M6	17	710	45	137	110
RB1100/35x47	35 x 47	62	68	32	47	54	60	8	M6	17	780	45	99	79
RB1100/38x50	38 x 50	66	72	32	47	54	60	8	M6	17	850	45	91	74
RB1100/40x53	40 x 53	69	75	32	47	54	60	8	M6	17	890	45	86	70
RB1100/42x55	42 x 55	71	78	32	47	54	60	8	M6	17	940	45	82	67
RB1100/45x59	45 x 59	80	86	45	62	70	78	8	M8	41	1 900	82	102	82
RB1100/48x62	48 x 62	81	87	45	62	70	78	8	M8	41	2 000	82	96	78
RB1100/50x65	50 x 65	86	92	45	62	70	78	8	M8	41	2 100	82	91	75
RB1100/55x71	55 x 71	92	98	55	73	81	89	9	M8	41	2 500	93	77	63
RB1100/60x77	60 x 77	98	104	55	73	81	89	9	M8	41	2 800	93	70	58
RB1100/85x84	85 x 84	105	111	55	73	81	89	9	M8	41	3 000	93	65	53
RB1100/70x90	70 x 90	113	119	65	86	96	106	9	M10	83	5 300	152	84	69
RB1100/75x95	75 x 95	119	126	65	86	96	106	9	M10	83	5 700	152	78	65
RB1100/80x100	80 x 100	125	131	65	86	96	106	12	M10	83	8 100	203	98	83
RB1100/85x106	85 x 106	131	137	65	86	96	106	12	M10	83	8 600	203	92	78
RB1100/90x112	90 x 112	137	144	65	86	96	106	12	M10	83	9 100	203	87	74
RB1100/95x120	95 x 120	142	149	65	86	96	106	14	M10	83	11 200	236	95	80
RB1100/100x125	100 x 125	153	160	70	94	107	119	12	M12	145	15 100	303	108	92
RB1100/110x140	110 x 140	168	174	70	94	107	119	12	M12	145	16 600	303	97	82
RB1100/120x155	120 x 155	187	198	90	115	128	140	16	M12	145	24 200	404	93	77
RB1100/130x165	130 x 165	197	208	90	115	128	140	16	M12	145	26 200	404	85	72

Ma: Par de apriete Mt: Par máximo transmisible Fax: Esfuerzo axial máximo transmisible Pa: Presión en el eje Pm: Presión en el alojamiento